



# TETRA SwMI Interoperability Certificate

12 September 2002

## Motorola

Telelaboratoriet (TDC Mobil A/S) has witnessed that the Motorola infrastructure is operating in accordance with

TETRA Interoperability Profile – (TIP) Ver 2.1.1, March 2000

for following features:

Features	Tested(Yes/No)
• PSTN interconnect	Yes
• Individual duplex call	No
• Individual simplex call (direct setup)	No
• Status messages	Yes
• Unannounced cell re-selection	Yes
• Announced type 3 cell re-selection	Yes
• Emergency call	Yes

The tests have been performed on Motorola infrastructure on the following dates:  
On the 25<sup>th</sup> January 2000 with hardware/software release 2.3SER.

During the period 15<sup>th</sup>-16<sup>th</sup> September 2000 on Motorola infrastructure DIMETRA 3.0 with Ambassador switch: Hardware BLN7022A39, software: q100, and Site Controller: hardware 0.1.4, software: R070020.

During the period 19<sup>th</sup>-22<sup>th</sup> March 2001 on Motorola infrastructure DIMETRA R3.1.006 with Ambassador switch: Hardware BLN7022A39, software: q400, and Site Controller: Hardware 0.1.4, software: R030330.

Finally, during the period 27<sup>th</sup>-28<sup>th</sup> September and 1<sup>th</sup>-2<sup>th</sup> October 2001 on Motorola infrastructure DIMETRA R4.0.002 with Ambassador switch: Hardware BLN7022A39, software: Q201, and Site Controller: Hardware 0.1.4, software: R04.00.17.

The test results for the tested features can be found in table 1, 2, 3 and 4 of this certificate.

Authorised IOP test engineer

Telelaboratoriet, TDC Mobil

Preben Raae Hansen

Sven Lundbech

Telelaboratoriet (TDC Mobil A/S) has made every effort to ensure that tests have been made correctly, and in accordance with TIP V2. Telelaboratoriet (TDC Mobil A/S) has no liability for the test results, or towards the manufacturers.

Telelaboratoriet  
TDC Mobil A/S  
Telegade 2  
DK 2630 Taastrup

Tlf. +45 43 34 55 01  
Fax +45 43 71 59 02

E-mail: [info@telelaboratoriet.dk](mailto:info@telelaboratoriet.dk)

Web-site: <http://www.telelaboratoriet.dk>

## Information about the equipment used for testing

### Testing on the 26<sup>th</sup> January 2000:

The tests performed on 26<sup>th</sup> January 2000 were performed using the following terminals:

Manufacturer	Terminal Type	Software/Hardware Release No.
Motorola <sup>1</sup>	MTM300	R30.11.07
Nokia	TMR400	Hr01.0380
Marconi / OTE	Puma-T1	0.17
Simoco Digital Systems	SRP1000	4313 327 85911

They were used on Motorola infrastructure with hardware/software release 2.3SER.

### Testing on the 15<sup>th</sup>-16<sup>th</sup> September 2000:

The tests performed on 15<sup>th</sup>-16<sup>th</sup> of September 2000 were performed using the following terminals:

Manufacturer	Terminal Type	Software/Hardware Release No.
Motorola <sup>1</sup>	-	-
Nokia	THR420	SW: HY11.0390 HW: HRU 420-02
Marconi / OTE	Puma-T1	0.17
Simoco Digital Systems	SRM1000	SW: 4313 327 84844 HW:M81TT001T20C00000
Cleartone	CM9000P	SW: .32 HW:1
Teltronic	MDT-400	SW: 1 HW:1.0.

They were used on Motorola infrastructure DIMETRA 3.0 with Ambassador switch:  
Hardware BLN7022A39, software: q100, and Site Controller: Hardware 0.1.4, software:  
R070020.

---

<sup>1</sup> Terminals in their native system have not been targeted by IOP tests.

### Testing on the 19<sup>th</sup>-22<sup>th</sup> March 2001:

The tests performed during the period 19<sup>th</sup>-22<sup>th</sup> of March 2001 were performed using the following terminals:

Manufacturer	Terminal Type	Software/Hardware Release No.
Motorola <sup>1</sup>	-	-
Nokia	THR420E	SW: HY11.03-9 HW: HRU 420-02
Teltronic	MDT-400	SW: 01.02.01 HW: 01.03
Simoco Digital Systems	SRP1000	SW: 4313-327-72097 HW: PS3TT001T30000B
Simoco Digital Systems	SRM1000	SW: 4313-327-84844 HW: MS1TT001T20C0000

They were used on Motorola infrastructure DIMETRA R3.1.006 with Ambassador switch: Hardware BLN7022A39, software: q400, and Site Controller: Hardware 0.1.4, software: R030330.

### Testing on the 27<sup>th</sup>-28<sup>th</sup> September and on the 1<sup>th</sup>-2<sup>th</sup> October 2001:

The tests performed during the period 27<sup>th</sup>-28<sup>th</sup> September and 1<sup>th</sup>-2<sup>th</sup> October 2001 were performed using the following terminals:

Manufacturer	Terminal Type	Software/Hardware Release No.
Motorola <sup>1</sup>	-	-
Nokia	THR 850	SW: 2.16-0 HW: JL1-11
Marconi/OTE	PUMA T2	SW: TB23817F HW: 774-0162/01.01
Sepura	SRP1000	SW: 4313-327-72142 HW: PS3TT001T30000B
Sepura	SRM1000	SW: 4313-327-73043 HW: MS1TT00T20C0000

They were used on Motorola infrastructure DIMETRA R4.0.002 with Ambassador switch: Hardware BLN7022A39, software: Q201, and Site Controller: Hardware 0.1.4, software: R04.00.17.

<sup>1</sup> Terminals in their native system have not been targeted by IOP tests.

## Additional information about the tests performed

The tests were performed in the 380-400 MHz band. The SwMI was operating with the following configuration:

MCC	238
MNC	1
Colour code	41
LA20 (Høje Tåstrup) carrier frequency (BS Tx)	393.6125 MHz
LA24 (Høje Tåstrup) carrier frequency (BS Tx)	393.5375 MHz
PSTN gateway	43488011
Subscriber classes	FFFF <sub>16</sub>

## Test Results

The test results are shown in four tables. Table 1 is the test result as given in the TIPv2 certificate dated 06 June 2000. The information from the TIPv2 certificate dated 06 June 2000 is repeated here for informative purposes only.

### Table 1 Test results from 26<sup>th</sup> January 2000:

Table 1 indicates the number of tests for each feature and the corresponding number of tests completed for each terminal.

For call setup, the two tests cover MS initiated setup and reception of a setup initiated from another station.

DTMF over-dial tests the transfer of DTMF digits from the terminal and the corresponding tone generation.

Setup queuing refers to the situation where the call is made on a busy site and the call is placed in a resource queue thus prolonging the setup phase. The call is subsequently completed when resources become available.

Status message testing includes transmission of uplink status and downlink acknowledgement status indicating success/failure of delivery.

The cell re-selection tests cover cell re-selection as well as call restoration for group call and simplex individual call.

### Table 2 Test results from 15<sup>th</sup>-16<sup>th</sup> September 2000 and table 3 Test results from 19<sup>th</sup>-22<sup>th</sup> March 2001 and table 4 Test results from 27<sup>th</sup>-28<sup>th</sup> September and 1<sup>th</sup>-2<sup>th</sup> October 2001:

Table 2, 3 and 4 indicates whether or not tests addressing a specific requirement of the TIP specification have been performed, whether or not the requirement is applicable for the combination of the SwMI and the terminal, and the result of the test if executed.

Each entry of the table may take one of six values: -: No test performed, N/A: Not applicable, P: Pass, F: Fail, I: Inconclusive or NTA: No test case being available. NTA will only be allocated if both SwMI and terminal has indicated that they support (comply with) the corresponding feature (requirement); if either has indicated the feature (requirement) as not being supported then the entry will be N/A. In case of all entries of a row being N/A it should be assumed that this feature is not supported by the SwMI.



The test results have been derived from examining the behaviour of a live system. The verdicts indicated are based on the log evaluation of the information exchange between the SwMI and the terminals indicated in table 2, 3 and 4. The verdicts reflect the fact that at the time of the IOP testing it was/was not possible to demonstrate a behaviour that was in accordance with the related requirement.

**Table 1: Test performed on the 25<sup>th</sup> January 2000**

Motorola SwMI	# of tests <sup>1</sup>	Marconi-OTE Puma-T1	Motorola MTM300	Nokia TMR400	Simoco Digital Systems SRP1000
<b>PSTN interconnect</b>					
Setup	2	2	2	2	2
Clearing	1	1	1	1	1
DTMF over-dial	0	0	0	0	0
setup queuing	1	1	1	1	1
<b>Status messages</b>	1	1	1	1	1
<b>Individual call (duplex)</b>					
setup (on/off hook) (In coming/out going)	0	0	0	0	0
Modification to simplex	0	0	0	0	0
Clearing	0	0	0	0	0
<b>Individual call (simplex)</b>					
setup (direct)	0	0	0	0	0
setup queuing	0	0	0	0	0
<b>Emergency group call</b>					
Setup	2	2	2	2	0
Clearing	1	1	1	1	0
speech item request	0	0	0	0	0
<b>Emergency individual call</b>					
Setup	0	0	0	0	0
Clearing	0	0	0	0	0
speech item request	0	0	0	0	0
<b>Cell re-selection</b>					
Unannounced	2	1	2	2	1
announced type 3	6	5	4	5	5

<sup>1</sup> This column indicates the total number of different test that has been executed for the SwMI. Each of the subsequent columns indicates the number of different tests, which have been executed using a specific combination of MS and SwMI. The number of tests in each column may be less than the total number of available test cases due to some test cases not being relevant for a given combination of MS and SwMI.

**Table 2: Test performed during the period 15<sup>th</sup>-16<sup>th</sup> September 2000**

Abbreviations:                      -: Not performed.                      F: Fail  
    N/A: Not applicable                      I: Inconclusive  
    P: Pass    NTA: No test case available

Motorola SwMI	Marconi-OTE Puma-T1	Motorola MTM300	Nokia THR420	Simoco Digital Systems SRM1000	Clearstone CM9000P	Teltronic MDT-400
<b>6 Registration</b>						
6.1 ITSI attach	-	N/A	P	P	N/A	P
6.2 ITSI attach including group attachment	-	-	N/A	N/A	P	N/A
6.3 Roaming location updating	-	-	P	P	P	P
6.4 De-registration	-	-	-	-	P	P
<b>7 Individual call</b>						
7.1 Call setup	-	-	P	P	P	P
7.1 Call setup(Queuing)	-	-	-	-	(P) <sup>1</sup>	P
7.1.1 Hook signalling (simplex)	-	-	-	(P) <sup>2</sup>	-	(P) <sup>2</sup>
7.1.1 Hook signalling (Duplex)	N/A	N/A	N/A	N/A	N/A	N/A
7.1.2 Direct through-connect (Simplex)	-	-	-	-	-	-
7.1.2 Direct through-connect (Duplex)	N/A	N/A	N/A	N/A	N/A	N/A
7.1.3 Call setup Modifications						
7.1.3 (Duplex to Semi duplex)	N/A	N/A	N/A	N/A	N/A	N/A
7.1.3.2 Setup modification by called party						
7.1.3.2.1 Direct to hook	-	-	(P) <sup>2</sup>	-	(P) <sup>2</sup>	-
7.2 Transmission control						
7.2.1 End of transmission	-	-	P	P	P	P
7.2.2 Request to transmit	-	-	P	P	P	P <sup>3</sup>
7.2.3 Request for speech item	-	-	F <sup>4</sup>	-	P	P
7.3 Call maintenance	NTA	NTA	NTA	NTA	NTA	NTA
7.4 Call disconnection	-	-	-	-	-	-
7.5 Emergency individual call	-	-	-	-	I <sup>5</sup>	-
7.5.1 Emergency speech item request	-	-	-	-	-	-
7.5.2 Emergency individual call modification	-	-	-	-	-	-
<b>8 Group management</b>						
8.4 MS Attachment of the selected group	-	-	P	P	P	P
8.4 MS Attachment of the selected group (Rejection)	-	-	-	-	P	P
8.4 MS Attachment of the Null group	-	-	-	-	F <sup>6</sup>	F <sup>6</sup>
8.4 MS Change of the selected group	-	-	-	-	P	P
8.5 Multiple group attachment	-	-	-	-	N/A	-
8.6 MS initiated detachment	-	-	-	-	-	-
8.7 SwMI initiated group attachment and detachment						
8.7.1 SwMI initiated detachment	N/A	N/A	N/A	N/A	N/A	N/A
8.7.2 SwMI initiated attachment	N/A	N/A	N/A	N/A	N/A	N/A
8.7.3 SwMI initiated group reporting	N/A	N/A	N/A	N/A	N/A	N/A
8.7.4 SwMI initiated registration with group report request	N/A	N/A	N/A	N/A	N/A	N/A

Telelaboratoriet (TDC Mobil A/S) has made every effort to ensure that tests have been made correctly, and in accordance with TIP V2.  
 Telelaboratoriet (TDC Mobil A/S) has no liability for the test results, or towards the manufacturers.

Motorola SwMI	Marconi-OTE Puma-T1	Motorola MTM300	Nokia THR420	Simoco Digital Systems SRM1000	Clearstone CM9000P	Teltronic MDT-400
<b>9 Group call</b>						
9.1 Call setup	-	-	P	P	P	P
9.1 Call setup (Queuing)	-	-	-	-	P	P
9.1.1 Call setup modifications	NTA	NTA	NTA	NTA	NTA	NTA
9.2.1 End of transmission	-	-	P	P	P	P
9.2.2 Request to transmit	-	-	P	P	P	P
9.2.3 Request for speech item	-	-	F <sup>4</sup>	-	P	P
9.3 Call disconnection	-	-	P	P	P	P
9.4 Late entry	-	-	-	-	P	P
9.5 Emergency group call	-	-	-	N/A	-	-
9.5 Emergency group call(Setup to busy group)	-	-	-	N/A	I <sup>5</sup>	I <sup>7</sup>
9.5.1 Emergency speech item request	-	-	-	N/A	-	-
9.5.2 Emergency group call modification	-	-	-	N/A	-	-
<b>10 Cell re-selection</b>						
10.1 Undeclared cell re-selection	-	-	-	P	P	P
10.2.1 Unannounced cell re-selection with call restoration						
10.2.1 (Group call)	-	-	-	P <sup>5</sup>	P	F <sup>8</sup>
10.2.1 (Queuing, group call)	-	-	-	-	F <sup>9</sup>	F <sup>8</sup>
10.2.1 (individual call)	-	-	-	-	P	
10.2.1 (Queuing, individual call)	N/A	N/A	N/A	N/A	N/A	N/A
10.2.2 Announced cell re-selection without Preferred Neighbour Selected with call restoration						
10.2.2 (Group call)	-	-	-	P	(P) <sup>5</sup>	F <sup>10</sup>
10.2.2 (Queuing, group call)	-	-	I <sup>11</sup>	-	-	-
10.2.2 (Pre-emption, group call)	-	-	I <sup>11</sup>	-	-	-
10.2.2 (individual call, traffic)	-	-	-	-	I	-
10.2.2 (individual call, inactivity)	-	-	(P) <sup>8</sup>	-	P	-
10.2.2 (Queuing, individual call, traffic)	-	-	-	-	-	-
10.2.2 (Queuing, individual call, inactivity)	-	-	-	-	-	-
<b>11 Short data service</b>						
11.1 Status messages (to dispatcher)	-	-	-	-	P	P
11.1 Status messages (Text messaging)	-	-	-	-	-	-
<b>12 Telephone call</b>						
12.1 Gateway Addresses	NTA	NTA	NTA	NTA	NTA	NTA
12.2 Call Set-up	-	-	-	-	-	-
12.2.1 MS Originated, Late Through-Connect	-	-	-	-	-	-
12.2.2 MS Originated, Early Through-Connect	-	-	-	-	-	-
12.2.3 MS Originated, Call Queued	-	-	-	-	-	-
12.2.4 MS Terminated	-	-	-	-	-	-
12.3 Call Maintenance	NTA	NTA	NTA	NTA	NTA	NTA
12.4 DTMF Over-dial	-	-	-	-	-	-
12.5 Disconnect Causes	NTA	NTA	NTA	NTA	NTA	NTA
12.6 Emergency telephone call	NTA	NTA	NTA	NTA	NTA	NTA



**Comments:**

- 1) The log does give evidence of the SwMI sending a D\_INFO with queuing indication, however this cannot be found in the MS log.
- 2) 'Call Status' element is missing in D-CALL PROCEEDING. Incorrect value of the transmission grant element in the D-SETUP PDU.
- 3) Incorrect priority in U-TX DEMAND (Pre-emptive instead of Low/high)
- 4) The MS is unable to get the speech Item, unable to pre-empt the ongoing call.
- 5) The log from the SwMI is missing signalling information.
- 6) The attachment of the null group is not acknowledged by the Motorola SwMI.
- 7) MS log is missing.
- 8) The verdict is based on observations made during the test session since sufficient logging is missing to make a more dedicated evaluation of the behaviour.
- 9) MS restores with location area of old cell, location area is missing in log from MS.
- 10) The MS send U-RESTORE without registration and attachment.
- 11) There is a mismatch between SwMI log and MS log that makes it impossible to assign a verdict.

**Table 3: Test performed during the period 19<sup>th</sup>-22<sup>th</sup> March 2001**

Abbreviations:

 -: Not performed.  
 N/A: Not applicable  
 P: Pass

 F: Fail  
 I: Inconclusive  
 NTA: No test case available

Motorola SwMI	Marconi-OTE Puma-T1	Motorola MTM300	Nokia THR420E	Simoco Digital Systems SRM1000	Simoco Digital Systems SRP1000	Cleartone CM9000P	Teltronic MDT-400
<b>6 Registration</b>							
6.1 ITSI attach	-	-	-	-	-	-	-
6.2 ITSI attach including group attachment	-	-	N/A	N/A	N/A	-	N/A
6.3 Roaming location updating	-	-	P	-	-	-	P
6.4 De-registration	-	-	-	-	-	-	-
<b>7 Individual call</b>							
7.1 Call setup	-	-	-	-	-	-	(P) <sup>1</sup>
7.1 Call setup (Queuing)	-	-	-	-	-	-	-
7.1.1 Hook signalling (simplex)	-	-	-	-	-	-	-
7.1.1 Hook signalling (Duplex)	N/A	N/A	N/A	N/A	N/A	N/A	N/A
7.1.2 Direct through-connect (Simplex)	N/A	N/A	N/A	N/A	N/A	N/A	N/A
7.1.2 Direct through-connect (Duplex)	N/A	N/A	N/A	N/A	N/A	N/A	N/A
7.1.3 Call setup Modifications							
7.1.3 (Duplex to Semi duplex)	N/A	N/A	N/A	N/A	N/A	N/A	N/A
7.1.3.2 Setup modification by called party							
7.1.3.2.1 Direct to hook	-	-	-	-	-	-	-
7.2 Transmission control							
7.2.1 End of transmission	-	-	-	-	-	-	P
7.2.2 Request to transmit	-	-	-	-	-	-	P
7.2.3 Request for speech item	-	-	-	-	-	-	P
7.3 Call maintenance	NTA	NTA	NTA	NTA	NTA	NTA	NTA
7.4 Call disconnection	-	-	-	-	-	-	-
7.5 Emergency individual call							
7.5.1 Emergency speech item request	N/A	N/A	N/A	N/A	N/A	N/A	N/A
7.5.2 Emergency individual call modification	N/A	N/A	N/A	N/A	N/A	N/A	N/A
<b>8 Group management</b>							
8.4 MS Attachment of the selected group	-	-	-	-	-	-	-
8.4 MS Attachment of the selected group (Rejection)	-	-	-	-	-	-	-
8.4 MS Attachment of the Null group	-	-	-	-	-	-	-
8.4 MS Change of the selected group	-	-	-	-	-	-	-
8.5 Multiple group attachment	-	-	P	P	P	-	P
8.5 Multiple group attachment (Rejection)	-	-	F <sup>2</sup>	F <sup>2</sup>	F <sup>2</sup>	-	F <sup>2</sup>
8.6 MS initiated detachment	-	-	-	-	-	-	N/A
8.7 SwMI initiated group attachment and detachment							
8.7.1 SwMI initiated detachment	N/A	N/A	N/A	N/A	N/A	N/A	N/A
8.7.2 SwMI initiated attachment	N/A	N/A	N/A	N/A	N/A	N/A	N/A
8.7.3 SwMI initiated group reporting	N/A	N/A	N/A	N/A	N/A	N/A	N/A
8.7.4 SwMI initiated registration with group report request	N/A	N/A	N/A	N/A	N/A	N/A	N/A

Telcelaboratoriet (TDC Mobil A/S) has made every effort to ensure that tests have been made correctly, and in accordance with TIP V2. Telcelaboratoriet (TDC Mobil A/S) has no liability for the test results, or towards the manufacturers.

Motorola SwMI	Marconi-OTE Puma-T1	Motorola MTM300	Nokia THR420E	Simoco Digital Systems SRM1000	Simoco Digital Systems SRR1000	Clearstone CM9000P	Teltronic MDT-400
<b>9 Group call</b>							
9.1 Call setup	-	-	-	-	-	-	-
9.1 Call setup (Queuing)	-	-	-	-	-	-	-
9.1.1 Call setup modifications	NTA	NTA	NTA	NTA	NTA	NTA	NTA
9.2.1 End of transmission	-	-	P	-	-	-	-
9.2.2 Request to transmit	-	-	-	-	-	-	-
9.2.3 Request for speech item	-	-	P	-	-	-	-
9.3 Call disconnection	-	-	-	-	-	-	-
9.4 Late entry	-	-	-	-	-	-	-
9.5 Emergency group call	-	-	-	N/A	N/A	-	P
9.5 Emergency group call(Setup to busy group)	-	-	-	N/A	N/A	-	P
9.5.1 Emergency speech item request	-	-	-	N/A	N/A	-	P
9.5.2 Emergency group call modification	N/A	N/A	N/A	N/A	N/A	N/A	N/A
<b>10 Cell re-selection</b>							
10.1 Undeclared cell re-selection	-	-	-	-	-	-	-
10.2.1 Unannounced cell re-selection with call restoration							
10.2.1 (Group call)	-	-	-	-	-	-	P <sup>3</sup>
10.2.1 (Queuing, group call)	-	-	P	-	-	-	-
10.2.1 (individual call)	-	-	-	-	-	-	-
10.2.1 (Queuing, individual call)	N/A	N/A	N/A	N/A	N/A	N/A	N/A
10.2.2 Announced cell re-selection without Preferred Neighbour Selected with call restoration							
10.2.2 (Group call)	-	-	P	-	-	-	-
10.2.2 (Queuing, group call)	-	-	-	-	-	-	-
10.2.2 (Pre-emption, group call)	-	-	-	-	-	-	-
10.2.2 (individual call, traffic)	-	-	-	-	-	-	-
10.2.2 (individual call, inactivity)	-	-	-	-	-	-	-
10.2.2 (Queuing, individual call, traffic)	-	-	-	-	-	-	-
10.2.2 (Queuing, individual call, inactivity)	-	-	-	-	-	-	-
<b>11 Short data service</b>							
11.1 Status messages (to dispatcher)	-	-	-	-	-	-	-
11.1 Status messages (Text messaging)	-	-	-	-	-	-	-
<b>12 Telephone call</b>							
12.1 Gateway Addresses	NTA	NTA	NTA	NTA	NTA	NTA	NTA
12.2 Call Set-up	-	-	-	-	-	-	-
12.2.1 MS Originated, Late Through-Connect	-	-	-	-	-	-	-
12.2.2 MS Originated, Early Through-Connect	-	-	-	-	-	-	P
12.2.3 MS Originated, Call Queued	-	-	-	-	-	-	P
12.2.4 MS Terminated	-	-	-	-	-	-	P
12.3 Call Maintenance	NTA	NTA	NTA	NTA	NTA	NTA	NTA
12.4 DTMF Over-dial	-	-	-	-	-	-	F <sup>4</sup>
12.5 Disconnect Causes	NTA	NTA	NTA	NTA	NTA	NTA	NTA
12.6 Emergency telephone call	N/A	N/A	N/A	N/A	N/A	N/A	N/A



**Comments:**

- 1) The call setup is modified correctly to hook setup by the SwMI. The 'Call Status' element is missing in D-CALL PROCEEDING. Incorrect value in the transmission grant element in the D-SETUP PDU.
- 2) When the MS attaches a group unknown to the SwMI it is accepted. However, if the group is attached as the selected group, the SwMI rejects the unknown group.
- 3) The test is performed with an MS continuously transmitting instead of a stationary unit (dispatcher).
- 4) The MS does not send U-INFO PDUs with DTMF tone start, only U-INFO PDUs with DTMF tone stop.

**Table 4: Test performed during the period 27<sup>th</sup>-28<sup>th</sup> September and 1<sup>th</sup>-2<sup>th</sup> October 2001**

Abbreviations:

 -: Not performed.  
 N/A: Not applicable  
 P: Pass

 F: Fail  
 I: Inconclusive  
 NTA: No test case available

Motorola SwMI	Marconi-OTE PUMA T2	Motorola MTM 300	Nokia THR 850	Sapura SRM1000	Sapura SRP1000	Cleartone CM9000P	Teltronic MDT-400
<b>6 Registration</b>							
6.1 ITSI attach	P	-	P	P	-	-	-
6.2 ITSI attach including group attachment	N/A	-	N/A	N/A	N/A	-	-
6.3 Roaming location updating	P	-	P	-	-	-	-
6.4 De-registration	P	-	P	P	-	-	-
<b>7 Individual call</b>							
7.1 Call setup	P <sup>2,3</sup>	-	P <sup>1,2,3</sup>	-	-	-	-
7.1 Call setup (Queuing)	F <sup>4</sup>	-	P	P	-	-	-
7.1.1 Hook signalling (simplex)	P	-	N/A	-	-	-	-
7.1.1 Hook signalling (Duplex)	N/A	N/A	N/A	N/A	N/A	N/A	N/A
7.1.2 Direct through-connect (Simplex)	N/A	N/A	N/A	N/A	N/A	N/A	N/A
7.1.2 Direct through-connect (Duplex)	N/A	N/A	N/A	N/A	N/A	N/A	N/A
7.1.3 Call setup Modifications							
7.1.3 (Duplex to Semi duplex)	N/A	N/A	N/A	N/A	N/A	N/A	N/A
7.1.3.2 Setup modification by called party							
7.1.3.2.1 Direct to hook	N/A	N/A	N/A	N/A	N/A	N/A	N/A
7.2 Transmission control							
7.2.1 End of transmission	P	-	P	-	-	-	-
7.2.2 Request to transmit	P	-	P	-	-	-	-
7.2.3 Request for speech item	N/A	-	P	-	-	-	-
7.3 Call maintenance	N/A	N/A	N/A	N/A	N/A	N/A	N/A
7.4 Call disconnection	P <sup>5</sup>	-	-	P <sup>6</sup>	-	-	-
7.5 Emergency individual call							
7.5.1 Emergency speech item request	N/A	N/A	N/A	N/A	N/A	N/A	N/A
7.5.2 Emergency individual call modification	N/A	N/A	N/A	N/A	N/A	N/A	N/A
<b>8 Group management</b>							
8.4 MS Attachment of the selected group	P	-	P	-	-	-	-
8.4 MS Attachment of the selected group (Rejection)	P	-	P	-	-	-	-
8.4 MS Attachment of the Null group	N/A	-	P	-	-	-	-
8.4 MS Change of the selected group	P	-	P	-	-	-	-
8.5 Multiple group attachment	P	-	P	-	-	-	-
8.5 Multiple group attachment (Rejection)	-	-	F <sup>7</sup>	-	-	-	-
8.6 MS initiated detachment	P	-	-	-	-	-	-
8.7 SwMI initiated group attachment and detachment							
8.7.1 SwMI initiated detachment	N/A	N/A	N/A	N/A	N/A	N/A	N/A
8.7.2 SwMI initiated attachment	N/A	N/A	N/A	N/A	N/A	N/A	N/A
8.7.3 SwMI initiated group reporting	N/A	N/A	N/A	N/A	N/A	N/A	N/A
8.7.4 SwMI initiated registration with group report request	N/A	N/A	N/A	N/A	N/A	N/A	N/A

Telelaboratoriet (TDC Mobil A/S) has made every effort to ensure that tests have been made correctly, and in accordance with TIP V2. Telelaboratoriet (TDC Mobil A/S) has no liability for the test results, or towards the manufacturers.

Motorola SwMI	Marconi-OTE PUMA T2	Motorola MTM 300	Nokia THR 850	Sapura SRM1000	Sapura SRP1000	Clearstone CM9000P	Teltronic MDT-400
<b>9 Group call</b>							
9.1 Call setup	P	-	P	-	-	-	-
9.1 Call setup (Queuing)	P	-	(P) <sup>8</sup>	-	-	-	-
9.1.1 Call setup modifications	NTA	NTA	NTA	NTA	NTA	NTA	NTA
9.2.1 End of transmission	P	-	P	-	-	-	-
9.2.2 Request to transmit	P	-	P	-	-	-	-
9.2.3 Request for speech item	N/A	-	P	-	-	-	-
9.3 Call disconnection	P	-	P	-	-	-	-
9.4 Late entry	P	-	P	-	-	-	-
9.5 Emergency group call	P	-	N/A	P	P	-	-
9.5 Emergency group call (Setup to busy group)	P	-	N/A	P	P	-	-
9.5.1 Emergency speech item request	F <sup>9</sup>	-	N/A	P	P	-	-
9.5.2 Emergency group call modification	N/A	N/A	N/A	N/A	N/A	N/A	N/A
<b>10 Cell re-selection</b>							
10.1 Undeclared cell re-selection	P	-	P	-	-	-	-
10.2.1 Unannounced cell re-selection with call restoration							
10.2.1 (Group call)	F <sup>10</sup>	-	F <sup>11</sup>	-	-	-	-
10.2.1 (Queuing, group call)	-	-	-	-	-	-	-
10.2.1 (individual call)	N/A	-	N/A	N/A	N/A	-	-
10.2.1 (Queuing, individual call)	N/A	-	N/A	N/A	N/A	-	-
10.2.2 Announced cell re-selection without Preferred Neighbour Selected with call restoration							
10.2.2 (Group call)	-	-	P	-	-	-	-
10.2.2 (Queuing, group call)	-	-	-	-	-	-	-
10.2.2 (Pre-emption, group call)	-	-	N/A	-	-	-	-
10.2.2 (individual call, traffic)	-	-	-	-	-	-	-
10.2.2 (individual call, inactivity)	-	-	-	-	-	-	-
10.2.2 (Queuing, individual call, traffic)	-	-	-	-	-	-	-
10.2.2 (Queuing, individual call, inactivity)	-	-	-	-	-	-	-
<b>11 Short data service</b>							
11.1 Status messages (to dispatcher)	P	-	P	-	-	-	-
11.1 Status messages (Text messaging)	-	-	-	-	-	-	-
<b>12 Telephone call</b>							
12.1 Gateway Addresses	NTA	NTA	NTA	NTA	NTA	NTA	NTA
12.2 Call Set-up	P <sup>3</sup>	-	P <sup>3</sup>	-	-	-	-
12.2.1 MS Originated, Late Through-Connect	-	-	-	-	-	-	-
12.2.2 MS Originated, Early Through-Connect	P	-	P	-	-	-	-
12.2.3 MS Originated, Call Queued	P	-	P	-	-	-	-
12.2.4 MS Terminated	P	-	-	-	-	-	-
12.3 Call Maintenance	N/A	N/A	N/A	N/A	N/A	N/A	N/A
12.4 DTMF Over-dial	P	-	F <sup>12</sup>	-	-	-	-
12.5 Disconnect Causes	NTA	NTA	NTA	NTA	NTA	NTA	NTA
12.6 Emergency telephone call	N/A	N/A	N/A	N/A	N/A	N/A	N/A

**Comments:**

1) The SwMI does not support direct simplex setup and the Nokia terminal does not support Hook simplex setup. Therefore the SwMI correctly modifies the call setup to hook setup.

2) Incorrect value in the Transmission grant element in the D-SETUP PDU.

3) The 'Call Status' element is missing in D-CALL-PROCEEDING.

4) During the setup phase, the MS sends U-DISCONNECT after 20 seconds with the disconnection cause 'expiry of timer'.

It seems that the MS ignores the Call Time-Out, Set-Up Phase timer with the value of '60 seconds' send by the SwMI in the D-CALL-PROCEEDING PDU.

5) Among several call disconnection causes, only 'Expiry of timer' is tested.

6) Among several call disconnection causes, only 'User requested disconnect' is tested.

7) When the MS attaches a group unknown to the SwMI it is accepted. However if the group is attached as the selected group the SwMI rejects the unknown group.

8) The MS does not show queuing in the display.

9) The SwMI does not assign call ownership to the MS.

If the MS is not assigned call ownership, the MS is not able to perform emergency speech item request, which is incorrect behaviour.


10) In the D-CALL-RESTORE PDU the SwMI includes the optional element New Call Identifier element to assign a new call ID at the new cell. The MS sends U-DISCONNECT with disconnection cause "invalid call id".

11) The MS sends U-RESTORE on the new cell, but the group call restoration fails and the SwMI sends D-RESTORE-FAIL.

12) The MS is not able to send DTMF over-dial.

### Test setup description

All tests except re-selection test are carried out on a single site system with one carrier using standard antenna configurations.

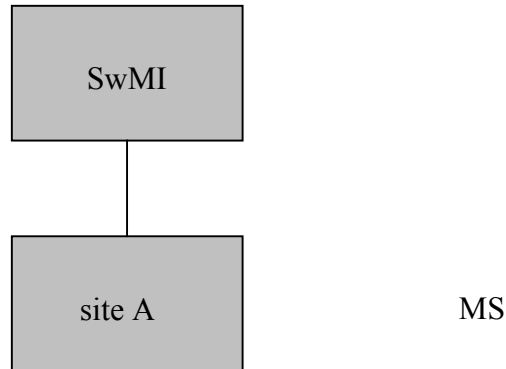

For the cell re-selection test, an additional site is activated and the roaming MS is connected to the system via RF cables as illustrated below.

