

# TETRA Interoperability Certificate

**EASTCOM , eTRA, SwMI –  
Funk-Electronic Piciorgros, TMO-100, Terminal**

Köln, March 2017

Latest Certified SwMI SW Release:	V3.1.0.0	Latest Certified Terminal SW Release:	V3.15
Latest Certified SwMI HW Release:	V5.2.0.0	Latest Certified Terminal HW Release:	3

ISCTI (Istituto Superiore delle Comunicazioni e delle Tecnologie dell'Informazione) certifies, that the EASTCOM , eTRA, SwMI and the Funk-Electronic Piciorgros, TMO-100, terminal have been subject to interoperability testing for the “certified” features listed on second page of this certificate, in accordance with the TETRA Interoperability Profiles, TIP compliance Test Plan and related TETRA interoperability requirement tables.

The table lists all the available TETRA interoperability profiles, and summarizes the main functionalities of every profile according to the TETRA interoperability requirement tables.

A feature is “Certified” when it has been successfully tested during the last test session with one of the testing method described in the TETRA process document part 1 (TPD001-01).

A breakdown into the feature details is given in the Feature Compliance Overview section of this certificate.


This certificate has been issued following a partially witnessed single test session between EASTCOM and Funk-Electronic Piciorgros on March 2017. Detailed test results are listed in the Test Report associated to this Certificate. Details and explanation about the procedure used to provide verdicts are in the TIC process TPD001-01.

**IOP test engineer**




Roberto Feroci

**Head of the Procedure**

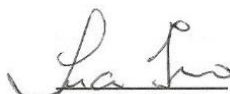

Ivano Luciani

**Radio Office Manager**

Giuseppe Pierri  


ISCTI - V.le America 201, 00144 Rome, Italy  
Ph.: +39 06 5444 2135, Fax: +39 06 5410904  
e-mail: [tetra\\_ctc.iscom@mise.gov.it](mailto:tetra_ctc.iscom@mise.gov.it),  
Web: [www.mise.gov.it](http://www.mise.gov.it)

**Date of issue  
24 March 2017**

v 1

## Certified features

Tetra Association TTR001-01:Core	
Registration	Certified
Group Management	Certified
Group call	Certified
Individual call	-
Status messages	Certified
Pre-emptive Priority Call	Certified
Emergency Call	Certified
Cell Re-selection	Certified
PSTN interconnect	-
MS-ISDN Numbering	-
In Call Signalling	Certified
Subscriber Class Procedures	Certified
Common Secondary Control Channels	Certified
BS Fallback Operation	-
Energy Economy Mode	-
Transmit Inhibit	-
Mixed band operation	-
Tetra Association TTR001-02:SDS	
SDS Type 1, 2 or 3	Certified
SDS-TL	Certified
Store and Forward	-
Multipart SDS	-
Tetra Association TTR001-04:Auth	
SwMI Initiated (non-mutual) Authentication	Certified
SwMI Initiated Authentication made Mutual by MS	Certified

<b>TEI Query</b>	-
<b>Tetra Association TTR001-05:PD</b>	
<b>Context Management</b>	Certified
<b>Single Slot Packet Data</b>	Certified
<b>Multi Slot Packet Data</b>	Certified
<b>TEDS</b>	-
<b>Mixed band operation</b>	-
<b>Tetra Association TTR001-09:AL</b>	
<b>Ambience Listening</b>	Certified
<b>Interaction with Transmit Inhibit</b>	-
<b>Tetra Association TTR001-13:ED</b>	
<b>Enable and temporary disable of an MS</b>	Certified
<b>Permanent disable of an MS</b>	Certified

## Feature Compliance Overview

The first pages of this certificate provide an indication about the main interoperable TETRA features for each TIP specification (as described in the TIC-RT). The main interoperable TETRA features' results depend on a set of sub-features, the verdicts associated to each sub-feature are directly derived from the analysis of the performed test cases.

The results associated to each feature and sub-feature are shown in the "Feature Compliance Report" table below. The main features are indicated with blue background and the associated sub-features (or second level features) have a white background.

The outcome assigned to a feature as shown on page 2, is derived by the Feature Compliance Report tables.

Outcome	Definition
<b>Certified</b>	All required tests have been performed and passed
<b>Partial</b>	Not all the required tests have been performed but none have failed
-	Feature cannot be certified e.g. it is not supported by at least one product, no tests were performed, or some tests were performed but at least one failed

The outcome is derived from the verdict assigned to a sub feature which is the result of an analysis of the test case results listed in the Test Report. The verdict assigned to each sub-feature is derived from one or several test case results or test steps result, the TETRA Interoperability requirement tables (TIC-RTs) indicate the link between sub-features and test cases for the certified set of equipment capabilities (see Test Report).

Verdict	Definition
<b>Passed</b>	All mandated tests or steps of tests linked to this functionality (as per TIC-RT indication) are compliant with the TIP specification relevant to this feature or sub-feature
<b>Incomplete</b>	Not all Mandated tests (as per TIC-RT indication) have been executed
<b>Failed</b>	At least one of mandated test or steps of tests linked to this functionality failed to match the TIP specification relevant to this feature or sub-feature

The verdict associated to the feature or sub-feature gives also indication about the method used to test that feature or sub-feature. The allowed testing Methods are listed in the table below, a complete description of the procedures and constraints associated to each of them can be found in the "TPD001-01 TETRA Interoperability Certification Process

Description" document.

Testing Method	Description
<b>Complete</b>	All mandated tests associated to the feature or sub-feature have been executed
<b>Spot</b>	Only a selection of the mandatory test cases associated to the feature or sub-feature has been executed during the test session. These tests are a subset of the tests performed on an equivalent software which has been "completely" tested against the same functionality on a different equipment, see manufacturer declaration in the associated Test Report
<b>Regression</b>	Only a selection of the mandatory test cases associated to the feature or sub-feature has been executed during the test session. These tests are a subset of the tests performed on a previous version of the same software which has been "completely" tested in a previous test session against the same functionality, see manufacturer definition in the associated Test Report
<b>Regression on spot</b>	The regression method (see the previous item) has been applied at this session on the verdicts from the referenced (previous) session where the spot testing method (see above) had been applied.
<b>Witnessed</b>	The TIP heading lines in the Feature Compliance Report indicate whether each TIP is partially or fully witnessed by the Certification Body. Additionally, for a partially-witnessed TIP, the number of witnessed test cases that passed is shown for each the feature and sub-feature. There may have been some un-witnessed passed tests and they will have been found to be successful based on the log file evaluation

Depending on equipment capabilities declared by the manufacturer, some features or sub features cannot be tested. The following table describes meaning of the used abbreviation:

Indication	Definition
<b>Not supported</b>	The SwMI and/or MS do not support the minimum features required to verify these items

ISCTI has made every effort to ensure that every result has been correctly evaluated in accordance with the relevant TIPs, Test Plans and TIC-RTs. ISCTI has no liability for the test results, or towards the manufacturers.

The table on the following page lists HW and SW releases of SwMI and Terminal under test in the last four test sessions and the used TIP specifications, Test Plans and TIC-RTs.

This Certificate and Certificates from previous test sessions are available on the TETRA + Critical Communications Association web site  
[\(https://tandcca.com/interoperability/interoperability-certificates-and-test-reports/\)](https://tandcca.com/interoperability/interoperability-certificates-and-test-reports/).

The feature results are shown in the tables below.

## Information on equipment under test and document references

<b>Test Session Date/Place</b>	<b>EASTCOM , Köln, March 2017</b>				
SwMI Type	eTRA				
SwMI HW Release	V5.2.0.0				
SwMI SW Release	V3.1.0.0				
Terminal Type	TMO-100				
Terminal HW Release	3				
Terminal SW Release	V3.15				
<b>TIP Specs and TIP Compliance Test Plans</b>					
<b>Core</b>	TTR001-01	v6.1.1			
	IOP001-01	v3.1.0			
	TIC-RT001-01	v2.6.7			
<b>SDS</b>	TTR001-02	v2.1.3			
	IOP001-02	v2.1.0			
	TIC-RT001-02	v2.1.9			
<b>Auth</b>	TTR001-04	v3.0.0			
	IOP001-04	v2.0.0			
	TIC-RT001-04	v2.2.8			

<b>PD</b>	TTR001-05	v4.1.0			
	IOP001-05	v4.1.0			
	TIC-RT001-05	v4.0.3			
<b>AL</b>	TTR001-09	v2.0.0			
	IOP001-09	v1.1.0			
	TIC-RT001-09	v1.2.7			
<b>ED</b>	TTR001-13	v2.0.0			
	IOP001-13	v1.0.0			
	TIC-RT001-13	v1.4.9			

## Feature compliance report

Test Session	EASTCOM , Köln, March 2017			
<b>Core - Partially Witnessed Testing</b>				
Registration	PASSED Complete 7_pass_of_7			
Initial registration	PASSED Complete 3_pass_of_3			
SwMI initiated location updating	PASSED Complete 1_pass_of_1			
LA timer based Periodic location updating	PASSED Complete 2_pass_of_2			
De-registration	PASSED Complete 1_pass_of_1			
Group Management	PASSED Complete 8_pass_of_8			
Single group attachment	PASSED Complete 4_pass_of_4			
Multiple group attachment	PASSED Complete 2_pass_of_2			
MS initiated group detachment	PASSED Complete 2_pass_of_2			
SwMI initiated group management	Not Supported			
Group call	PASSED Complete 8_pass_of_8			
Normal group call	PASSED Complete 3_pass_of_3			
Late entry	PASSED Complete 1_pass_of_1			
Priority Group scanning	PASSED Complete 1_pass_of_1			
Call setup modifications	PASSED Complete 1_pass_of_1			
Resource Queuing based on Call Priority	PASSED Complete 2_pass_of_2			



Broadcast Call	Not Supported			
Limited coverage notification	Not Supported			
Individual call				
Simplex individual call	Not Supported			
Duplex individual call	Not Supported			
Call setup modifications	Not Supported			
Resource Queuing based on Call Priority	Not Supported			
Indication of imminent call disconnection	Not Supported			
Status messages	PASSED Complete 4_pass_of_4			
Individual addressed Status transfer	PASSED Complete 1_pass_of_1			
Group addressed Status transfer	PASSED Complete 3_pass_of_3			
Pre-emptive Priority Call	PASSED Complete 1_pass_of_1			
Pre-emption of Resources	PASSED Complete 1_pass_of_1			
Pre-emption of Busy Users	Not Supported			
Emergency Call	PASSED Complete 1_pass_of_1			
Pre-emption of Resources	PASSED Complete 1_pass_of_1			
Pre-emption of Busy Users	Not Supported			
Call setup modifications	Not Supported			
Call disconnection by non-call owner	Not Supported			
Cell Re-selection	PASSED Complete 4_pass_of_4			
Undeclared	PASSED Complete 1_pass_of_1			
Unannounced	PASSED Complete 1_pass_of_1			
Announced - with Call Restoration	PASSED Complete 2_pass_of_2			
Announced - without Call Restoration	Not Supported			
Expedited	Not Supported			
Graceful Service Degradation Mode (GSDM)	Not Supported			
PSTN interconnect				
TETRA Originated Call	Not Supported			
PSTN Originated Call	Not Supported			

DTMF over-dial	Not Supported			
Emergency Telephone Calls	Not Supported			
MS-ISDN Numbering				
MS ISDN - Voice Call	Not Supported			
MS-ISDN Status	Not Supported			
In Call Signalling	PASSED Complete 4_pass_of_4			
Slow Signalling on Traffic Channel (SACCH)	PASSED Complete 2_pass_of_2			
Fast Signalling on Traffic Channel (FACCH)	PASSED Complete 2_pass_of_2			
Subscriber Class Procedures	PASSED Complete 2_pass_of_2			
Cell Selection based on Subscriber Class	PASSED Complete 2_pass_of_2			
Subscriber Class Delivery during Location Update	Not Supported			
Use of Preferred Subscriber Classes	Not Supported			
Common Secondary Control Channels	PASSED Complete 5_pass_of_5			
One C-SCCH per cell	PASSED Complete 2_pass_of_2			
Two C-SCCH per cell	PASSED Complete 3_pass_of_3			
Three C-SCCH per cell	PASSED Complete 2_pass_of_2			
BS Fallback Operation				
Switch to/from BS Fallback Operation	Not Supported			
Roaming to avoid a cell in BS Fallback Operation	Not Supported			
Services with BS Fallback Operation	Not Supported			
Ignore a cell in Fallback Operation	Not Supported			
User selectable Fallback behaviour	Not Supported			
Energy Economy Mode				
Energy Economy Mode Operation	Not Supported			
Transmit Inhibit				
TXI Activation & De-Activation	Not Supported			
TXI Activation & De-Activation with TxI Status available to the Dispatcher	Not Supported			
Receipt of group addressed service during TXI	Not Supported			
Mixed band operation				
Mixed band operation, inter-cell	Not Supported			

Mixed band operation, intra-cell	Not Supported			
Mixed band operation, Full	Not Supported			
<b>SDS - Partially Witnessed Testing</b>				
SDS Type 1, 2 or 3	PASSED Complete 3_pass_of_3			
SDS Type 1	PASSED Complete 1_pass_of_1			
SDS Type 2	PASSED Complete 1_pass_of_1			
SDS Type 3	PASSED Complete 1_pass_of_1			
SDS-TL	PASSED Complete 5_pass_of_5			
Individually Addressed	PASSED Complete 1_pass_of_1			
Group Addressed	PASSED Complete 2_pass_of_2			
Using MS-ISDN dialling	Not Supported			
SDS Reception	PASSED Complete 5_pass_of_5			
Using UCS2 coding scheme	Not Supported			
Using 7-bit coding scheme	Not Supported			
Using 8-bit Latin 1 coding scheme	PASSED Complete 3_pass_of_3			
Using 8-bit Latin 5 coding scheme	Not Supported			
Using 8-bit Latin 9 coding scheme	Not Supported			
Store and Forward				
Individually Addressed	Not Supported			
Group Addressed	Not Supported			
Multipart SDS				
Multipart SDS	Not Supported			
<b>Auth - Partially Witnessed Testing</b>				
SwMI Initiated (non-mutual) Authentication	PASSED Complete 2_pass_of_2			
Attach with authentication	PASSED Complete 1_pass_of_1			
Roaming with authentication	Not Supported			
SwMI rejects MS during authentication	PASSED Complete 1_pass_of_1			
MS rejects SwMI during authentication	Not Supported			

SwMI Initiated Authentication made Mutual by MS	PASSED Complete 1_pass_of_1			
Attach with authentication	PASSED Complete 1_pass_of_1			
Roaming with authentication	Not Supported			
TEI Query				
TEI Query Operation	Not Supported			
<b>PD - Partially Witnessed Testing</b>				
Context Management	PASSED Complete 10_pass_of_10			
Context Activation	PASSED Complete 6_pass_of_6			
User authentication	PASSED Complete 4_pass_of_4			
Single Slot Packet Data	PASSED Complete 9_pass_of_9			
Data Transfer	PASSED Complete 6_pass_of_6			
Cell re-selection	PASSED Complete 3_pass_of_3			
Packet Data Channel sharing	Not Supported			
Multi Slot Packet Data	PASSED Complete 2_pass_of_2			
Data Transfer	PASSED Complete 2_pass_of_2			
TEDS				
TEDS with Context Activation	Not Supported			
TEDS Data Transmission, using LLC Optimisation	Not Supported			
TEDS Cell Reselection, using LLC Optimisation	Not Supported			
Mixed band operation				
Mixed band operation, inter-cell	Not Supported			
Mixed band operation, intra-cell	Not Supported			
Mixed band operation, Full	Not Supported			
<b>AL - Partially Witnessed Testing</b>				
Ambience Listening	PASSED Complete 4_pass_of_4			
SS-AL Call Setup	PASSED Complete 2_pass_of_2			

MS initiated SS-AL disconnection	PASSED Complete 2_pass_of_2			
No Indication to affected user	PASSED Complete 4_pass_of_4			
Interaction with Transmit Inhibit				
AL can override TxI	Not Supported			
AL cannot override TxI	Not Supported			
<b>ED - Partially Witnessed Testing</b>				
Enable and temporary disable of an MS	PASSED Complete 10_pass_of_10			
Enable and temporary disable of an MS without authentication	PASSED Complete 2_pass_of_2			
Enable and temporary disable of an MS with authentication	PASSED Complete 2_pass_of_2			
Registration of a temporary disabled MS	PASSED Complete 2_pass_of_2			
Rejection of applicable invalid enable/disable requests	Not Supported			
Removable SIMs do not affect the subscriber or equipment that has been enabled/disabled	Not Supported			
Disabling of an MS during a call or while on the PDCH	PASSED Complete 4_pass_of_4			
Permanent disable of an MS	PASSED Complete 2_pass_of_2			
Permanent disable of an MS with authentication	PASSED Complete 1_pass_of_1			
Permanently Disabled MS cannot send air interface signalling	PASSED Complete 1_pass_of_1			